

S112S01 Series

S116S01 Series

SIP Type SSR for Medium Power Control

■ Features


1. Compact, high radiation resin mold package
2. RMS ON-state current
S112S01 Series: 12Arms at $T_c \leq 70^\circ\text{C}$
 (With heat sink)
S116S01 Series: 16Arms at $T_c \leq 60^\circ\text{C}$
 (With heat sink)
3. Built-in zero-cross circuit
(S112S02 / S212S02 / S116S02 / S216S02)
4. High repetitive peak OFF-state voltage
S112S01 / S112S02 / S116S01 / S116S02
 $V_{\text{DRM}} : 400\text{V}$
S212S01 / S212S02 / S216S01 / S216S02
 $V_{\text{DRM}} : 600\text{V}$
5. Isolation voltage between input and output
 $(V_{\text{iso}} : 4\,000V_{\text{rms}})$
6. Recognized by UL, file No. E94758
(S112S01 / S112S02)
(S116S01 / S116S02)
7. Approved by CSA, No. 63705
(S112S01 / S112S02)
(S116S01 / S116S02)

■ Applications

1. Copiers, laser beam printers
2. Automatic vending machines
3. FA equipment

■ Outline Dimensions

(Unit : mm)

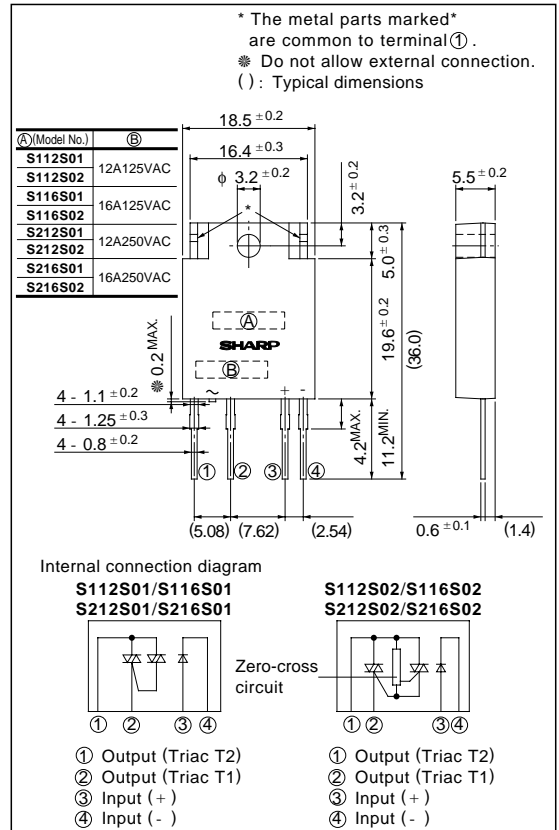

■ Model line-ups

	For 100V lines	For 200V lines
For phase control No built-in zero-cross circuit	S112S01	S212S01
	S116S01	S216S01
Built-in zero-cross circuit	S112S02	S212S02
	S116S02	S216S02

Absolute Maximum Ratings

(Ta = 25°C)

Parameter		Symbol	Rating	Unit
Input	Forward current	I _F	50	mA
	Reverse voltage	V _R	6	V
Output	RMS ON-state current	I _T	^{*4} 12	A _{rms}
			^{*5} 16	A _{rms}
	^{*1} Peak one cycle surge current	I _{surge}	120	A
			160	A
	Repetitive peak OFF-state voltage	V _{DRM}	400	V
			600	V
			400	V
	Non-repetitive peak OFF-state voltage	V _{DSM}	400	V
600			V	
Critical rate of rise of ON-state current		dI/dt	50	A/μs
Operating frequency		f	45 to 65	Hz
^{*2} Isolation voltage		V _{iso}	4 000	V _{rms}
Operating temperature		T _{opr}	- 25 to + 100	°C
Storage temperature		T _{stg}	- 30 to + 125	°C
^{*3} Soldering temperature		T _{sol}	260	°C

*1 AC 60Hz sine wave, T_j = 25°C start

*2 AC 60Hz for 1 minute, 40 to 60 % RH. Apply voltages between input and output by the dielectric withstand voltage tester with zero-cross circuit. (Input and output shall be shorted respectively) . (Note)

When the isolation voltage is necessary at using external heat sink, please use the insulation sheet.

*3 For 10 seconds

*4 T_C <= 70°C*5 T_C <= 60°C


Electrical Characteristics

(Ta = 25°C)

Parameter		Symbol	Conditions	MIN.	TYP.	MAX.	Unit	
Input	Forward voltage	V _F	I _F = 20mA	-	1.2	1.4	V	
	Reverse current	I _R	V _R = 3V	-	-	10 ⁻⁴	A	
Output	Repetitive peak OFF-state current		I _{DRM}	V _D = V _{DRM}	-	-	10 ⁻⁴	A
	ON-state voltage	S112S01 Series	V _T	Resistance load I _F = 20mA, I _T = 12Arms	-	-	1.5	V _{rms}
		S116S01 Series		Resistance load I _F = 20mA, I _T = 16Arms	-	-	1.5	V _{rms}
	Holding current		I _H	-	-	-	50	mA
	Critical rate of rise of OFF-state voltage		dV/dt	V _D = 2/3 • V _{DRM}	30	-	-	V/μs
	Critical rate of rise of commutating OFF-state voltage		(dV/dt) _C	T _j = 125°C, V _D = 400V, *6	5	-	-	V/μs
	Zero-cross voltage	S112S02 / S212S02 S116S02 / S216S02	V _{OX}	I _F = 8mA	-	-	35	V
Transfer characteristics	Minimum trigger current	S112S01 / S212S01 S116S01 / S216S01 S112S02 / S212S02 S116S02 / S216S02	I _{FT}	V _D = 12V, R _L = 30Ω	-	-	8	mA
				V _D = 6V, R _L = 30Ω	-	-	8	mA
	Isolation resistance		R _{ISO}	DC500V, RH = 40 to 60 %	10 ¹⁰	-	-	Ω
	Turn-on time	S112S01 / S212S01 S116S01 / S216S01 S112S02 / S212S02 S116S02 / S216S02	t _{on}	AC 50Hz	-	-	1	ms
					-	-	10	ms
Turn-off time		t _{off}	AC 50Hz	-	-	10	ms	
Thermal resistance (Between junction and case)		S112S01 series S116S01 series	R _{th(j-c)}	-	-	3.8	°C/W	
				-	-	3.3	°C/W	
Thermal resistance (Between junction and ambience)		R _{th(j-a)}	-	-	-	40	°C/W	


*6 S112S01 Series: dI_T/dt = -6A/msS116S01 Series: dI_T/dt = -8A/ms

Fig. 1 RMS ON-state Current vs. Ambient Temperature (S112S01Series)

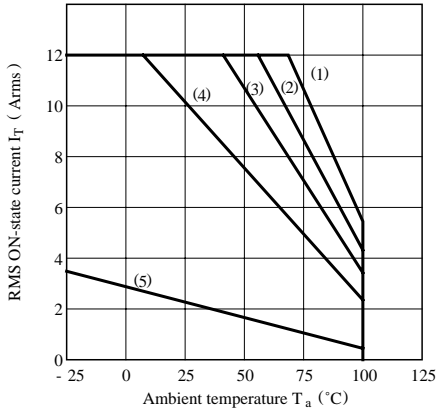

- (1) With infinite heat sink
- (2) With heat sink (280 x 280 x 2 mm Al plate)
- (3) With heat sink (200 x 200 x 2 mm Al plate)
- (4) With heat sink (100 x 100 x 2 mm Al plate)
- (5) Without heat sink

Fig. 2 RMS ON-state Current vs. Ambient Temperature (S116S01Series)

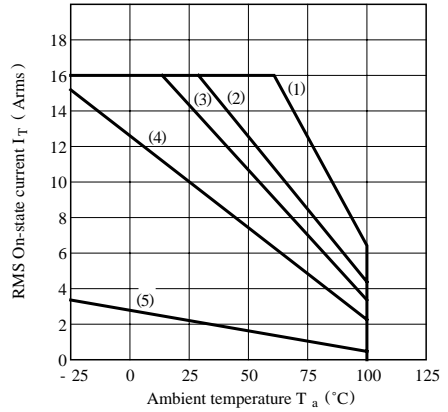

- (1) With infinite heat sink
- (2) With heat sink (280 x 280 x 2 mm Al plate)
- (3) With heat sink (200 x 200 x 2 mm Al plate)
- (4) With heat sink (100 x 100 x 2 mm Al plate)
- (5) Without heat sink

(Note) With the Al heat sink set up vertically, tighten the device at the center of the Al heat sink with a torque of 0.4N · m and apply thermal conductive silicone grease on the heat sink mounting plate. Forcible cooling shall not be carried out.

Fig. 3 RMS ON-state Current vs. Case Temperature

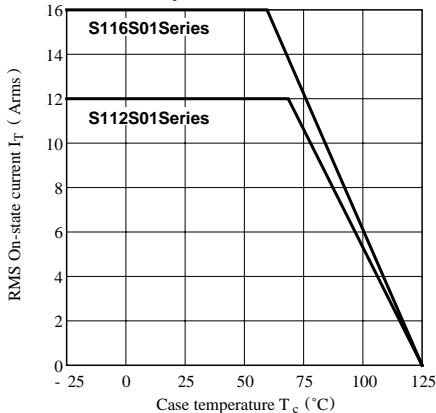


Fig. 4 Forward Current vs. Ambient Temperature

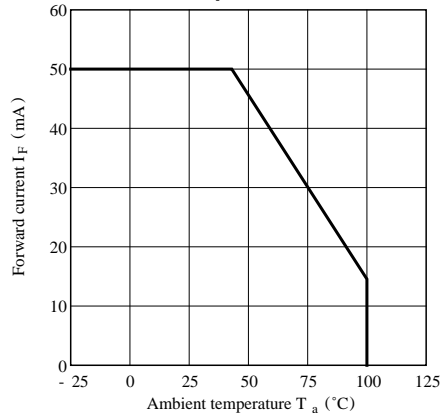


Fig. 5 Forward Current vs. Forward Voltage

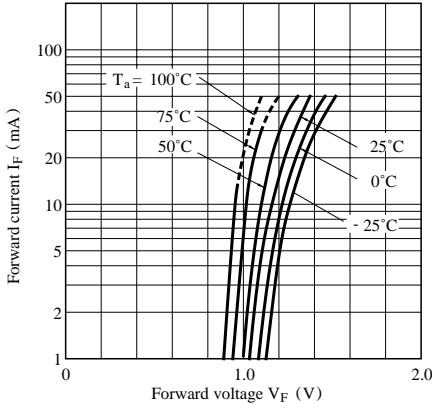


Fig. 6 Surge Current vs. Power-on Cycle

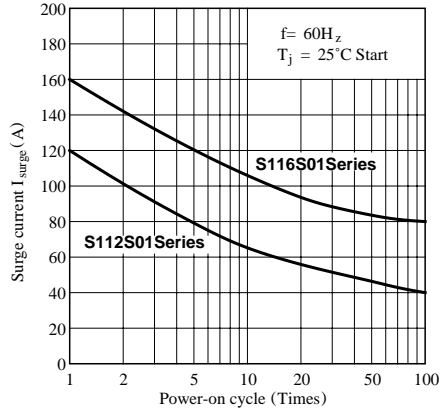


Fig. 7 Maximum ON-state Power Dissipation vs. RMS ON-state Current (S112S01Series)

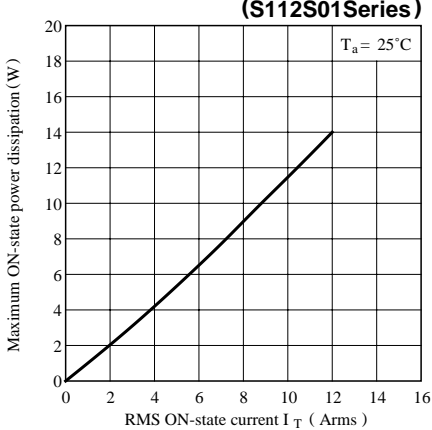


Fig. 8 Maximum ON-state Power Dissipation vs. RMS ON-state Current (S116S01Series)

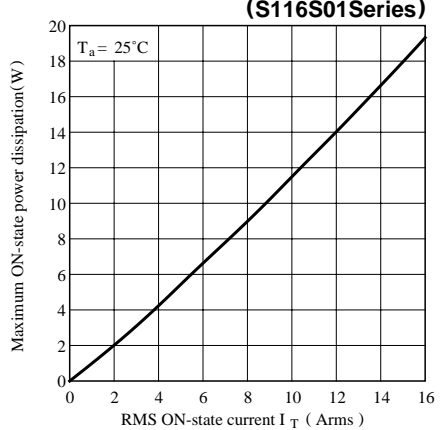


Fig. 9 Minimum Trigger Current vs. Ambient Temperature

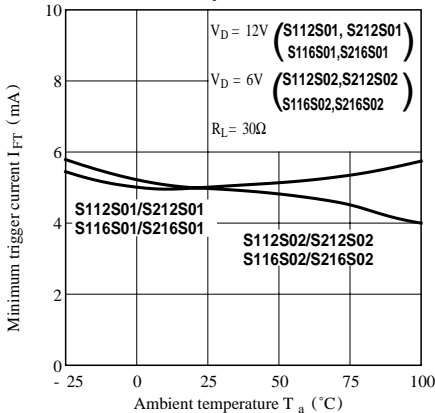


Fig.10 Repetitive Peak OFF-state Current vs. Ambient Temperature (S112S01/S112S02/S116S01/S116S02)


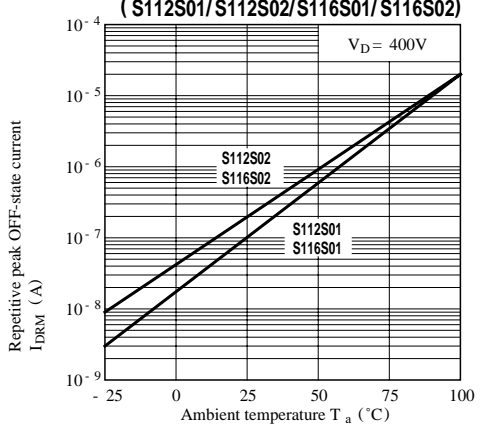


Fig.11 Repetitive Peak OFF-state Current vs. Ambient Temperature
(S212S01/S212S02/S216S01/S216S02)

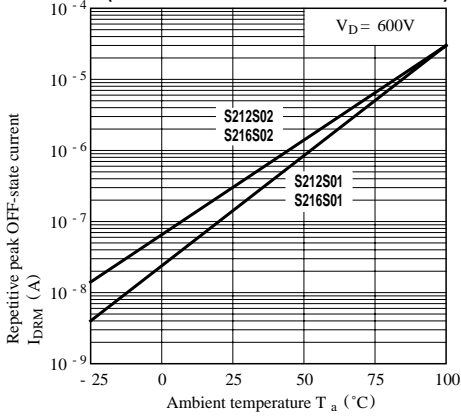

● Please refer to the chapter “Precautions for Use.”

NOTICE

- The circuit application examples in this publication are provided to explain representative applications of SHARP devices and are not intended to guarantee any circuit design or license any intellectual property rights. SHARP takes no responsibility for any problems related to any intellectual property right of a third party resulting from the use of SHARP's devices.
- Contact SHARP in order to obtain the latest device specification sheets before using any SHARP device. SHARP reserves the right to make changes in the specifications, characteristics, data, materials, structure, and other contents described herein at any time without notice in order to improve design or reliability. Manufacturing locations are also subject to change without notice.
- Observe the following points when using any devices in this publication. SHARP takes no responsibility for damage caused by improper use of the devices which does not meet the conditions and absolute maximum ratings to be used specified in the relevant specification sheet nor meet the following conditions:
 - (i) The devices in this publication are designed for use in general electronic equipment designs such as:
 - Personal computers
 - Office automation equipment
 - Telecommunication equipment [terminal]
 - Test and measurement equipment
 - Industrial control
 - Audio visual equipment
 - Consumer electronics
 - (ii) Measures such as fail-safe function and redundant design should be taken to ensure reliability and safety when SHARP devices are used for or in connection with equipment that requires higher reliability such as:
 - Transportation control and safety equipment (i.e., aircraft, trains, automobiles, etc.)
 - Traffic signals
 - Gas leakage sensor breakers
 - Alarm equipment
 - Various safety devices, etc.
 - (iii) SHARP devices shall not be used for or in connection with equipment that requires an extremely high level of reliability and safety such as:
 - Space applications
 - Telecommunication equipment [trunk lines]
 - Nuclear power control equipment
 - Medical and other life support equipment (e.g., scuba).
- Contact a SHARP representative in advance when intending to use SHARP devices for any "specific" applications other than those recommended by SHARP or when it is unclear which category mentioned above controls the intended use.
- If the SHARP devices listed in this publication fall within the scope of strategic products described in the Foreign Exchange and Foreign Trade Control Law of Japan, it is necessary to obtain approval to export such SHARP devices.
- This publication is the proprietary product of SHARP and is copyrighted, with all rights reserved. Under the copyright laws, no part of this publication may be reproduced or transmitted in any form or by any means, electronic or mechanical, for any purpose, in whole or in part, without the express written permission of SHARP. Express written permission is also required before any use of this publication may be made by a third party.
- Contact and consult with a SHARP representative if there are any questions about the contents of this publication.